



VOLKSWAGEN GOLF VII: 1KFF287

Vinnumber:	WVWZZZAUZFP100502	Versionname:	1.6 TDI 77KW BMT TRENDLINE
First Registrationdate:	21/04/2015	Fiscalpower:	
Expertise Mileage:	85565	Power Kw:	77
Bodytype:	Hatchback	Body color	Blue
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2108
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	SD
GPS storage	Luggage cover
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 H Steel			
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.
	Re.L.	Continental: 5 mm	Re.R.
		Continental: 4 mm	Continental: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2939,80
Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18



Wing R R, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover R L, Scratch(es), Acceptable

0,00

No pictures to display


Door F L, Scratch(es), LI - Repair and paint (complete)

318,35



Tailgate, Dent(s), LI - Repair and paint (complete)

301,68

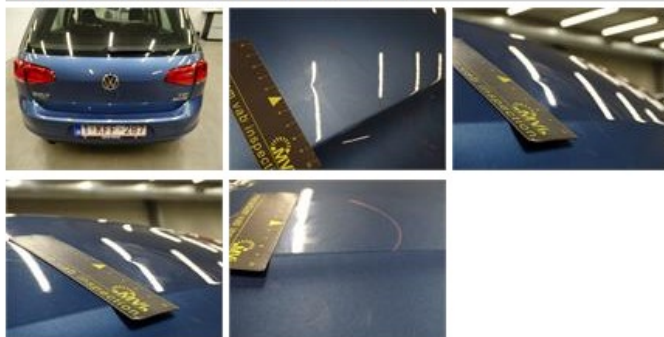

Boot carpet, Damaged, E - Replace

100,00



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50




Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Roof, Chemical polution, LI - Repair and paint (complete)

481,50

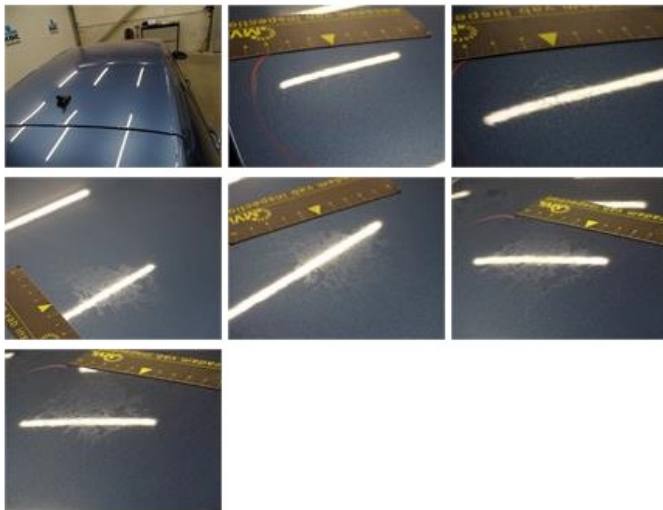

Rocker panel inner R L, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wheel cover R R, Scratch(es), E - Replace

30,00





Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)

115,56



Wheel cover F R, Scratch(es), E - Replace

30,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



No pictures to display