



VOLKSWAGEN Golf: 1HDC674

Vinnumber:	WVWZZZAUZFP503835	Versionname:	GOLF VAR Trendline 90PK
First Registrationdate:	23/06/2014	Fiscalpower:	
Expertise Mileage:	188859	Power Kw:	66
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2727
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	Tow bar removable
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 H Steel			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2443,76
Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Interior, Dirty, Acceptable	0,00
<i>No pictures to display</i>	
Windscreen, Stone chip(s), E - Replace	0,00



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Internal Boot Lining R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35




Door R L, Chemical polution, LI - Repair and paint (complete) 318,35



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



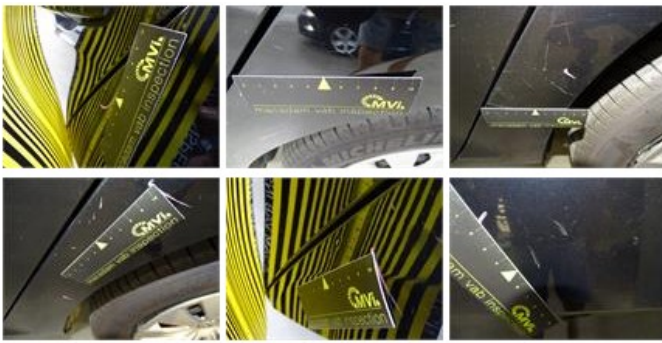


Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Rocker panel inner F L, Scratch(es), Repair/replace (lump sum) 115,56



Rear window, Scratch(es), E - Replace 0,00

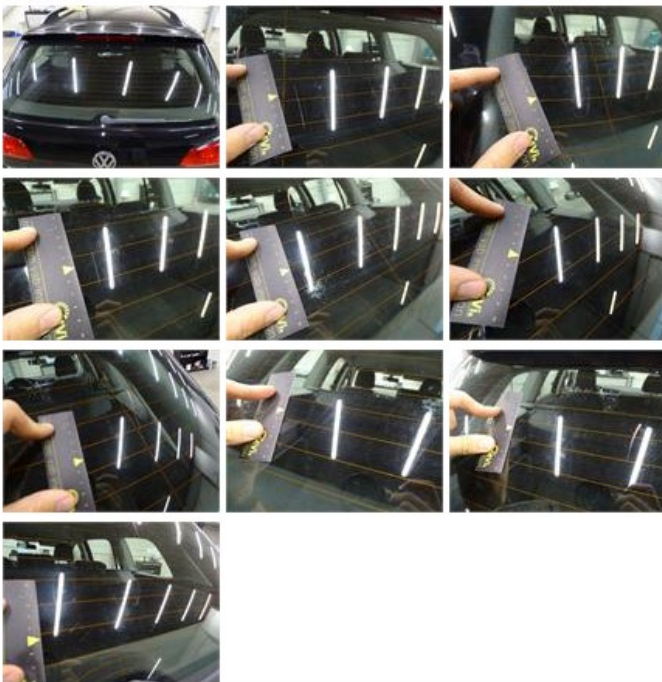


Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80






Roof, Chemical polution, LI - Repair and paint (complete) 481,50

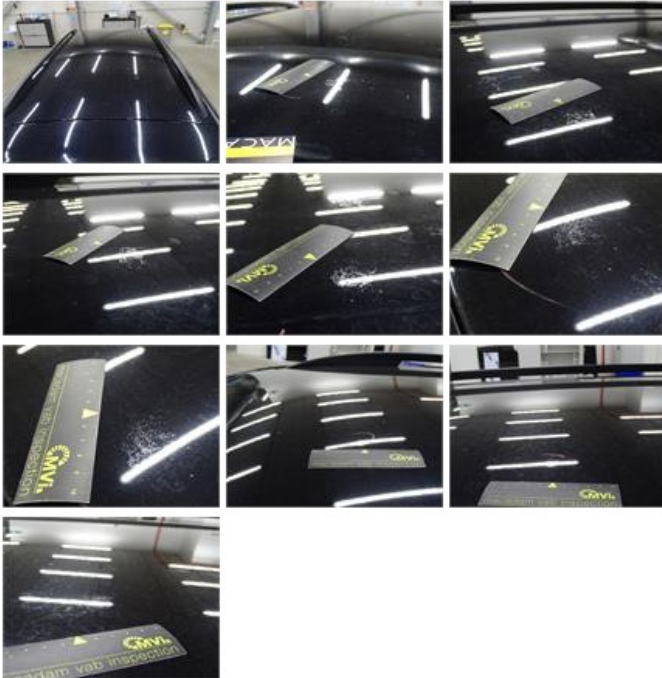

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

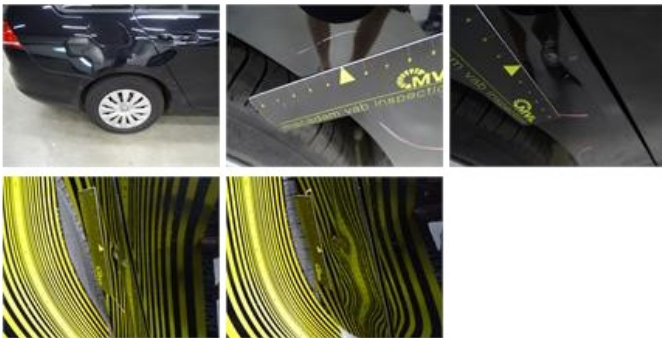

Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Rear spoiler, Chemical polution, Acceptable 0,00


No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Trunk lid covering R, Scratch(es), Smart repair 110,64



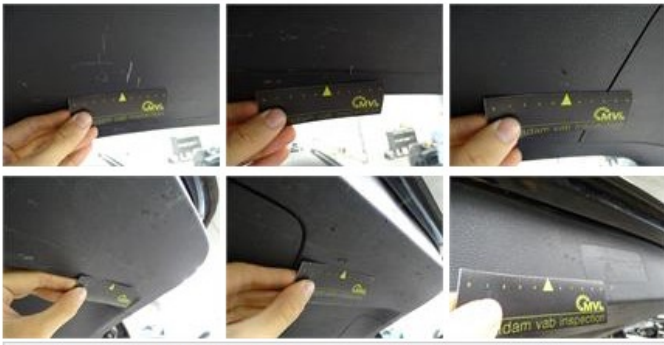

Floor covering F L, Hole, E - Replace

252,00

