


CITROEN C4 Picasso: 1GJA077

Vinnumber:	VF73A9HC8EJ558456	Versionname:	GR.C4 PICASSO Business GPS 115PK
First Registrationdate:	20/02/2014	Fiscalpower:	
Expertise Mileage:	178166	Power Kw:	85
Bodytype:	MPV	Body color	Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2604
Number of doors	5		
Number of seats	7		
Number head rests	7		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F	
GPS storage	Rear parking sensors	
GPS storage	HD Type of Tow bar	No Tow bar
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0


Total cost ex VAT	3669,27
Alloy rim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Broken, Le - Replace and paint	735,00



Bonnet, Stone chip(s), Acceptable	0,00
No pictures to display	
Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20



Alloy rim F R, Scratch(es), Acceptable	0,00
No pictures to display	
Roof, Chemical polution, LI - Repair and paint (complete)	481,50

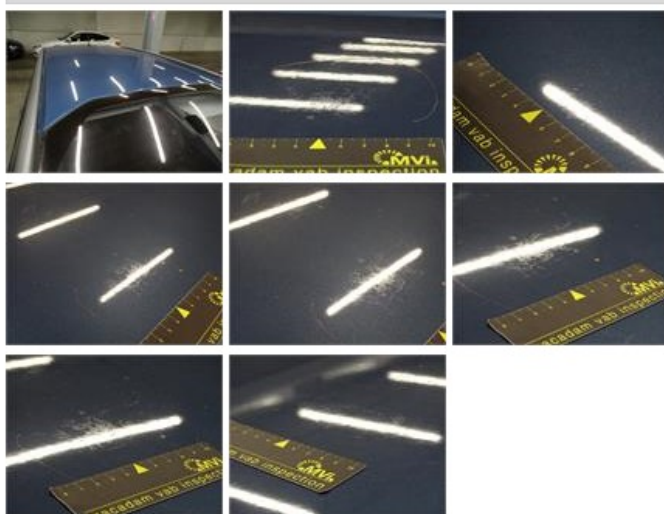

Rocker panel inner F R, Dent(s), Acceptable	0,00
No pictures to display	
Luggage space cover, Missing, E - Replace	240,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Rearview mirror housing L, Scratch(es), Acceptable	0,00
No pictures to display	
Bumper R, Scratch(es), Acceptable	0,00
No pictures to display	
Door R L, Dent(s) and scratch(es), Acceptable	0,00

Door R L, Dent(s) and scratch(es), Acceptable	0,00
No pictures to display	
Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)	310,50
	
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
	
Centre console, Scratch(es), Smart repair	110,64
	
Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
	
Rocker panel inner F L, Dent(s), Acceptable	0,00
No pictures to display	
Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18
	
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35

