


TOYOTA Auris: 1HHP097

Vinnumber:	SB1ZS3JE20E097190	Versionname:	AURIS TOUR.SP.HSD Dynamic CVT 99PK Aut.
First Registrationdate:	25/07/2014	Fiscalpower:	
Expertise Mileage:	175624	Power Kw:	73
Bodytype:	Break	Body color:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Hybrid Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4425
Number of doors:	5		
Number of seats:	5		
Number head rests:	2		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
GPS storage	Rear parking sensors
GPS storage	HD Type of Tow bar
Windows electric F	No Tow bar
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	205/55/16/91 V LightMetal			
	Fr.L.	Vredestein: 4 mm	Fr.R.	Vredestein: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment


Repair kit	No	Compressor	No
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	4427,06
Rearview mirror R complete, Broken, Le - Replace and paint	283,00



Windscreen, Stone chip(s), E - Replace

487,20

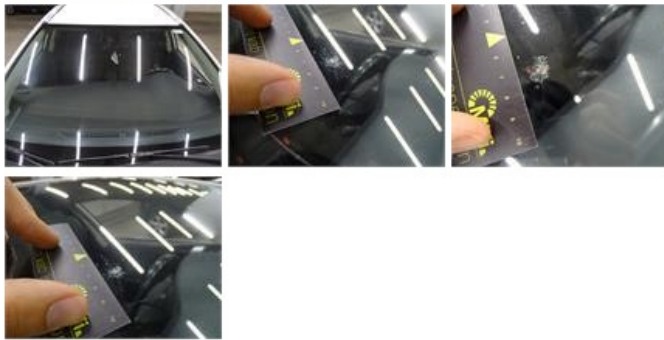

Tyre repair kit, Missing, E - Replace

210,53



Bodywork, Not original part, Acceptable

0,00

No pictures to display

Door F L, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display


Roof, Dent(s), PDR - Paintless dent repair

63,00



Wing F R, Dent(s), LI - Repair and paint (complete)

220,18

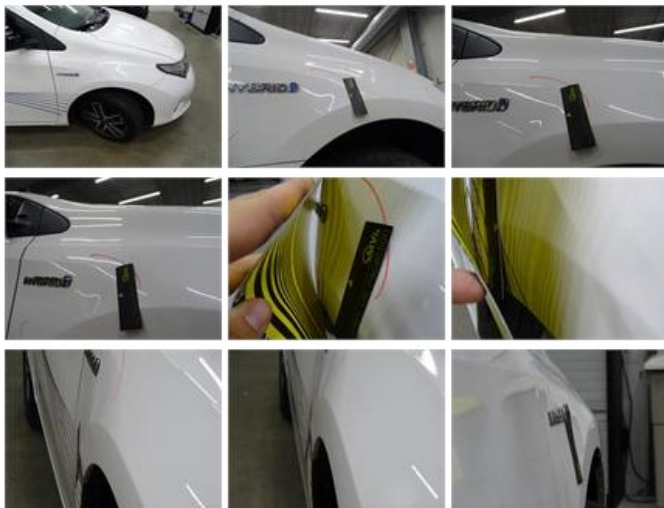

Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Headrest R M, Missing, E - Replace

60,00



Headrest R R, Missing, E - Replace

60,00



Luggage space cover, Missing, E - Replace

240,00



Wing R R, Dent(s), LI - Repair and paint (complete)

308,20



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing F L, Chemical polution, LI - Repair and paint (complete)

220,18



Trunk lid covering R, Scratch(es), Smart repair

110,64





Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Floor covering R, Hole, Smart repair

64,32



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Steering wheel, Worn, Acceptable

0,00




Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Interior, Dirty, Cleaning

50,00

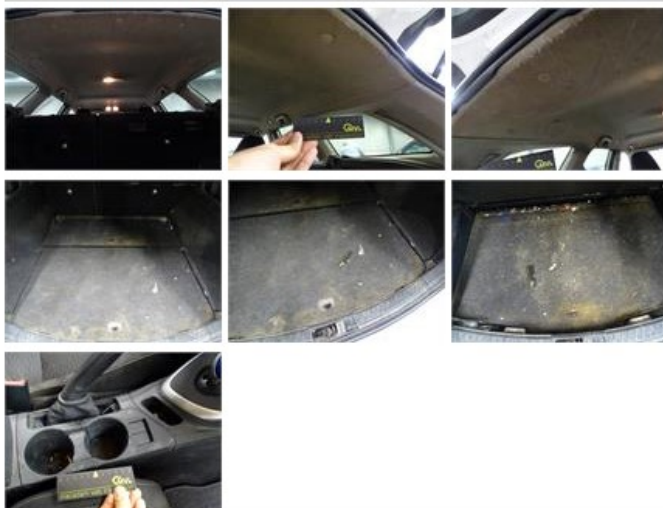

Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Headrest R L, Missing, E - Replace

60,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Roof pillar R, Dent(s), PDR - Paintless dent repair

63,00



Compressor, Missing, E - Replace

0,00



Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08

