



VOLKSWAGEN Golf: 1JEY188

Vinnumber:	WVWZZZAUZFP045057	Versionname:	GOLF BER Trendline 105PK
First Registrationdate:	28/11/2014	Fiscalpower:	
Expertise Mileage:	100360	Power Kw:	77
Bodytype:	Hatchback	Body color	Dark Blue
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3627
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunctional	Rear parking sensors
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control
Adaptive cruise control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	195/65/15/91 V Steel			
	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1854,03
Door F L, Scratch(es), Acceptable			0,00
No pictures to display			
Wheel cover F R, Scratch(es), E - Replace			30,00



Door R R, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display


Door R L, Scratch(es), LI - Repair and paint (complete)

318,35



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50

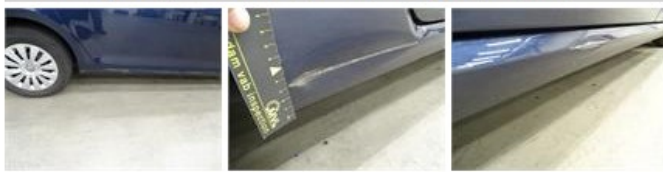


Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Roof, Chemical polution, LI - Repair and paint (complete)

481,50

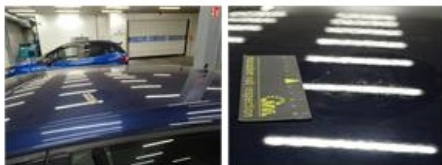

Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80

