



PEUGEOT 5008: 1KHJ971			
Vinnumber:	VF30A9HD8ES268927	Versionname:	1.6 HDI 84KW ACTIVE
First Registrationdate:	5/05/2015	Fiscalpower:	
Expertise Mileage:	197712	Power Kw:	84
Bodytype:	SUV	Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3312
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear				
Summer tyres:	205/60/16/96 H LightMetal			
	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Semperit: 4 mm	Re.R.	Semperit: 4 mm

Assistance equipment	
Total cost ex VAT	2364,46
Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20



Interior, Dirty, Cleaning	48,00
---------------------------	-------




Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete)	290,08
---	--------

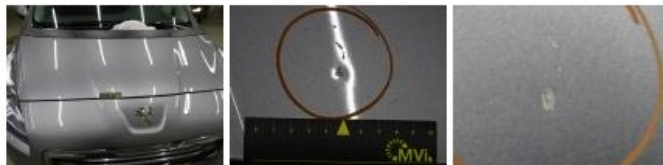


Door F L, Bump(s), PDR - Knock out without painting	63,00
---	-------



Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18
---	--------



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------

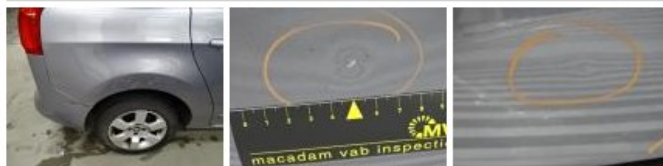



Door R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Bumper R, Tear, Le - Replace and paint	651,00
--	--------



Bumper grille, Damaged, E - Replace	74,00
-------------------------------------	-------

