



MERCEDES C: 1FXA812

Vinnnumber:	WDD2040021A923317	Versionname:	C BER 220CDI BE Edition Avantgarde 163PK
First Registrationdate:	25/11/2013	Fiscalpower:	
Expertise Mileage:	145755	Power Kw:	120
Bodytype:	Berline	Body color	Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Back	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	SERVICE B OVER 18100 KM	Parking lot	2110
Maintenance	OK		
Battery functioning	Yes		
Number of doors	4		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD Front parking sensors
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear

Winter tyres:	205/55/16/91 T LightMetal			
	Fr.L.	Michelin: 8 mm	Fr.R.	Michelin: 8 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Spare tyre compact	Yes	Jack	Yes
--------------------	------------	------	------------

Total cost ex VAT	0,00
-------------------	-------------

Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

No pictures to display

Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	---------------






Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------

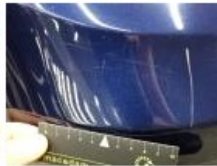

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Wheel aperture R R, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Front bumper, Stone chip(s), Acceptable	0,00
---	------

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Rear window, Scratch(es), E - Replace	0,00
---------------------------------------	------





Wing F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bonnet, Stone chip(s), Acceptable	0,00
-----------------------------------	------

No pictures to display

Roof, Scratch(es), LI - Repair and paint (complete)	481,50
---	--------

