




AUDI A3: 1FUE482			
Vinnnumber:	WAUZZZ8V3EA075842	Versionname:	A3 SB Attraction 105PK
First Registrationdate:	25/10/2013	Fiscalpower:	
Expertise Mileage:	101099	Power Kw:	77
Bodytype:	Hatchback	Body color	Brown
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1620
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options			
Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		

Degree of wear				
Winter tyres:	205/55/16/91 H LightMetal			
	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 2 mm	Re.R.	Michelin: 2 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			2866,80
Roof, Hail damage, PDR - Hail			1700,00

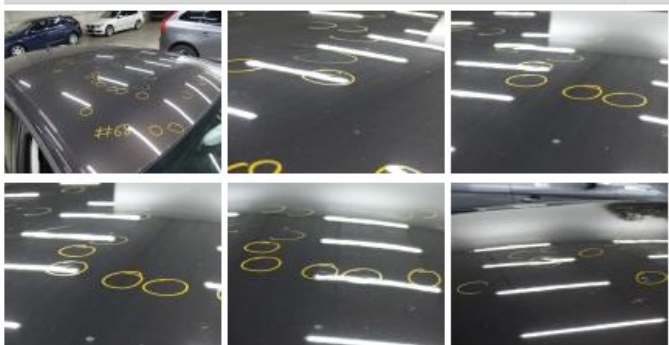




Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Quarter light R R, Scratch(es), E - Replace 141,00



Window R L door, Scratch(es), E - Replace 123,00

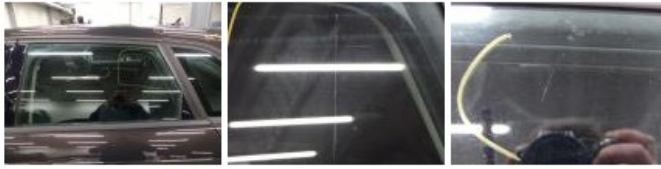

Window F R door, Scratch(es), E - Replace 123,00



Window F L door, Scratch(es), E - Replace 123,00



Windscreen, Stone chip(s), Windscreen repair 58,80



Tyre F R, Damaged, E - Replace 132,00



Bonnet, Hail damage, PDR - Hail 125,00





Window R R door, Scratch(es), E - Replace	123,00
---	--------



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Interior, Stain, Cleaning	48,00
---------------------------	-------



Roof pillar L, Hail damage, PDR - Hail	75,00
--	-------

