


OPEL ASTRA: 1DSG366

Vinnumber:	W0LOTGF48Y6078793	Versionname:	ASTRA
First Registrationdate:	17/03/2000	Fiscalpower:	
Expertise Mileage:	220696	Power Kw:	74
Bodytype:		Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3512
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	
Steering wheel multifunctional	
Type of headlighting:	Headlighting Halogen
Type of Lining:	Lining fabrics

Limited Technical Inspection

Tires wear profile:	OK	Battery functioning:	Yes
Idle position:	OK	Sound engine:	OK
Engine startingtime:	OK	Clutch test:	OK
Exhaust gass:	OK	Wiper fluid level:	OK
Transmission:	OK	Lighting:	OK
Handbrake:	OK	Wiperblades:	OK

Degree of wear

	185/65/15/88 H Steel			
Summer tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Vredestein: 3 mm	Re.R.	Vredestein: 3 mm

Assistance equipment

Spare wheel:	Yes	Jack:	Yes
--------------	------------	-------	------------

Total cost ex VAT	2156,32
-------------------	---------

Tailgate, Bump(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Rearview mirror housing L, Broken, E - Replace	99,00
--	-------



Sill outer R, Damaged, E - Replace	298,00
------------------------------------	--------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Luggage space cover, Unclasp(ed), Repair/replace (lump sum) 0,00

No pictures to display

Aerial, Damaged, Acceptable 0,00

No pictures to display

Wing R R, Bump(s), LI - Repair and paint (complete) 308,20



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18



Rearview mirror housing R, Scratch(es), Smart repair 110,64



Boot carpet, Stain, Acceptable 0,00

No pictures to display

Rear window, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Roof, Scratch(es), Acceptable 0,00

No pictures to display


Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover F R, Scratch(es), E - Replace 30,00

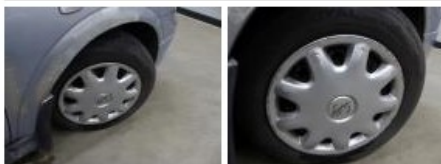

Wheel cover F L, Scratch(es), E - Replace 30,00

