
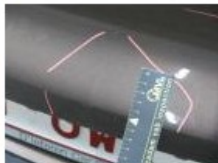


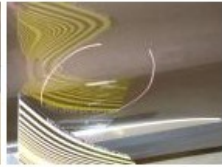

VOLKSWAGEN TIGUAN: 1GWE198			
Vinnumber:	WVGZZZ5NZEW116694	Versionname:	D
First Registrationdate:	16/05/2014	Fiscalpower:	
Expertise Mileage:	42314	Power Kw:	118
Bodytype:		Body color	Brown
Gearbox:	Automatic	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Petrol	Oil level	OK
Maintenance	NOT OK	Parking lot	4125
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		
Options			
Radio CD		Seats electric F L	
GPS storage		Sun Roof electric	
GPS storage	HD	Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		
Degree of wear			
Summer tyres:	215/60/17/96 V LightMetal		
	Fr.L.	Michelin: 5 mm	Fr.R.
			Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.
		Michelin: 6 mm	
Assistance equipment			
Spare tyre compact	Yes	Jack	Yes
Total cost ex VAT			2022,93
Maintenance, Maintenance, Execute			0,00
No pictures to display			
Tailgate, Scratch(es), LI - Repair and paint (complete)			301,68
			
Wing trim R R, Scratch(es), E - Replace			84,00

		Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	414,35
		Door trim F L, Scratch(es), E - Replace	114,00
		Mirror side blinker L, Broken, E - Replace	30,00
		Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	414,35
		Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete)	115,56
		Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
		Door trim R R, Scratch(es), E - Replace	114,00
		Bonnet, Scratch(es), 67 - Polish	55,19
		Rearview mirror L complete, Broken, E - Replace	168,00