



RENAULT Grand Scenic: 1EMIG31			
Vinnumber:	VF1JZ14B648263839	Versionname:	GR.SCENIC Energ.Dynamique 7pl.FAP
First Registrationdate:	22/01/2013		110PK
Expertise Mileage:	134556	Fiscalpower:	
Bodytype:	MPV	Power Kw:	81
Gearbox:	MAN 6 VIT	Body color	Grey
Transmission:		Paint type	Metalic
Fueltype:	Diesel	Rims summer	Aluminium
Battery functioning	Yes	Oil level	OK
Number of doors	5	Parking lot	1719
Number of seats	7		
Number head rests	7		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Options			
Radio CD		Sun Roof electric	
Windows electric F		Panoramic roof	
Windows electric R		Central consol F	
Cruise Control		Front parking sensors	
Steering wheel multifunction		Rear parking sensors	
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		
Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Sound engine	OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Wiper fluid level	OK
Exhaust gass	OK	Lighting	OK
Transmission	OK	Wiperblades	OK
Handbrake	OK		
Degree of wear			
Winter tyres:	205/50/15/96 H LightMetal		
	Fr.L.	Michelin: 4 mm	Fr.R.
		Michelin: 4 mm	
	Re.L.	Michelin: 5 mm	Re.R.
Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			3388,76
Wing R L, Chemical polution, LI - Repair and paint (complete)			308,20
			
Front bumper, Scratch(es), LI - Repair and paint (complete)			211,80
			
Roof, Chemical polution, LI - Repair and paint (complete)			481,50




Rocker panel inner F R, Bump(s) and scratch(es), LI - Repair and paint (complete)

115,56



Tailgate, Chemical pollution, LI - Repair and paint (complete)

301,68

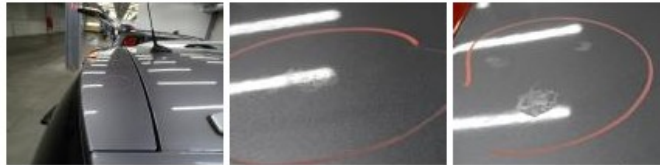

Bumper R, Bump(s) and scratch(es), Le - Replace and paint

651,00



Interior, Dirty, Cleaning

100,00



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Seat cover F L, Worn, Acceptable

0,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Rocker panel inner R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	115,56
---	--------



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
---	--------



Roof pillar R, Chemical polution, LI - Repair and paint (complete)	220,18
--	--------

