



MERCEDES E: 1FJM998				
Vinnumber:	WDD2122981A821530	Versionname:	E BRE 300 BlueTEC HYBRID 204PK Aut.	
First Registrationdate:	17/07/2013	Fiscalpower:		
Expertise Mileage:	154453	Power Kw:	150	
Bodytype:	Break	Body color	Black	
Gearbox:	Automatic	Paint type	Metalic	
Transmission:	Back	Rims summer	Aluminium	
Fueltype:	Hybrid Diesel	Oil level	OK	
Battery functioning	Yes	Parking lot	1206	
Number of doors	5			
Number of seats	5			
Number head rests	5			
Rims summer	Aluminium			
Category	Passenger Car			
Oil level	OK			
Options				
Radio CD		Central consol F		
Windows electric F		Luggage cover		
Windows electric R		Front parking sensors		
Cruise Control		Rear parking sensors		
Steering wheel multifunctional				
Seats F heated				
Radio multimedia				
Type of headlighting	Headlighting LED			
Type of GPS	GPS big screen color			
Type of Lining	Lining leather			
Type of climate control	Autom climate control			
Limited Technical Inspection				
Airco functioning	OK	Battery functioning	Yes	
Tires wear profile	OK	Sound engine	OK	
Idle position	OK	Clutch test	OK	
Engine startingtime	OK	Wiper fluid level	OK	
Exhaust gass	OK	Lighting	OK	
Transmission	OK	Wiperblades	OK	
Handbrake	OK			
Degree of wear				
Winter tyres:	245/45/17/99 V LightMetal			
	Fr.L.	Michelin: 9 mm	Fr.R.	Michelin: 9 mm
	Re.L.	Michelin: 9 mm	Re.R.	Michelin: 9 mm
Assistance equipment				
Repair kit	Yes	Compressor	Yes	
Total cost ex VAT			4384,44	
Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)			382,02	
Door R L, Bump(s), Acceptable			0,00	
No pictures to display				
Bonnet, Bump(s), Le - Replace and paint			1205,64	



Bumper R, Scratch(es), LI - Repair and paint (complete)	254,16
---	--------



Boot carpet, Chemical polution, E - Replace	120,00
---	--------




Roof, Hail damage, LI - Repair and paint (complete)	577,80
---	--------



Alloy rim F L polished, Scratch(es), I - Repair	155,00
---	--------



Alloy rim R L polished, Scratch(es), I - Repair	155,00
---	--------

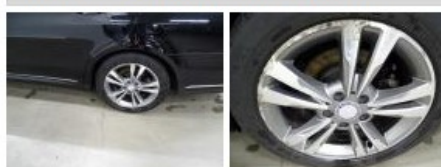

Wing R L, Bump(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete)	362,02
---	--------



Alloy rim R R polished, Scratch(es), I - Repair	155,00
---	--------



Alloy rim F R polished, Scratch(es), I - Repair	155,00
---	--------



Front bumper, Damaged, Le - Replace and paint

862,80

