



VOLKSWAGEN Passat: 1JNX946			
Vinnnumber:	WVWZZZ3CZFE071987	Versionname:	PASSAT VAR Highline
First Registrationdate:	28/01/2015	Fiscalpower:	140PK
Expertise Mileage:	153563	Power Kw:	103
Bodytype:	Break	Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1505
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options	
Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Steering wheel multifunctional	Luggage cover
Seats F heated	Front parking sensors
Type of headlighting	Rear parking sensors
Type of GPS	
Type of Lining	
Type of climate control	
Headlighting Halogen	
GPS big screen color	
Lining leather	
Autom climate control	

Limited Technical Inspection			
Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear			
Winter tyres:	235/45/17/97 V LightMetal		
	Fr.L.	Michelin: 4 mm	Fr.R.
	Re.L.	Michelin: 7 mm	Re.R.
		Michelin: 4 mm	Michelin: 7 mm

Assistance equipment	
Repair kit	No
Compressor	No
Total cost ex VAT	3134,60
Bumper R, Bump(s) and scratch(es), Le - Replace and paint	651,00



Wing F L, Bump(s) and scratch(es), Le - Replace and paint	0,00
---	------




Luggage space cover, Damaged, E - Replace 240,00



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00



Door R L, Bump(s) and scratch(es), Le - Replace and paint 0,00

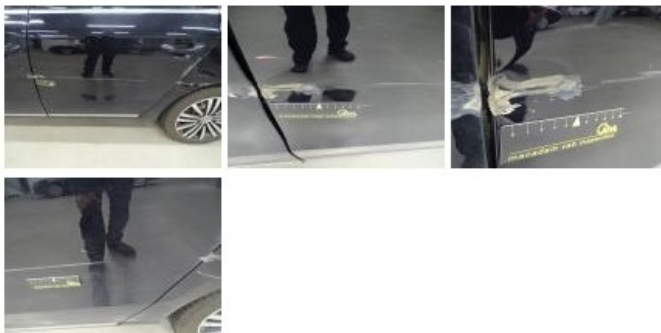

Ignition key, Missing, E - Replace 150,00

No pictures to display

Interior, Dirty, Cleaning 100,00



Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Maintenance book, Missing, E - Replace	0,00
--	------

No pictures to display

Door F L, Bump(s) and scratch(es), Le - Replace and paint	1082,52
---	---------



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)	0,00
---	------



Tyre repair kit, Missing, E - Replace	210,53
---------------------------------------	--------



Bumper F L, Scratch(es), Acceptable	0,00
-------------------------------------	------

No pictures to display

Wing R R, Missing, E - Replace	74,00
--------------------------------	-------



Windscreen, Repaired, Acceptable	0,00
----------------------------------	------

