



TOYOTA Auris: 1EAB081			
Vinnnumber:	SB1KS56E90E059333	Versionname:	AURIS HSD Luna 100PK
First Registrationdate:	1/10/2012	Fiscalpower:	
Expertise Mileage:	111710	Power Kw:	73
Bodytype:	Hatchback	Body color	Grey
Gearbox:	Automatic	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Hybrid Petrol	Oil level	OK
Battery functioning	Yes	Parking lot	4331
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options	
Radio CD	Central consol F
GPS storage	SD Luggage cover
GPS storage	
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control


Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Winter tyres:	195/65/15/91 T LightMetal			
	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 7 mm	Re.R.	Bridgestone: 7 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1070,03
Interior, Stain, Cleaning			50,00



Roof, Chemical polution, LI - Repair and paint (complete)	481,50
---	--------

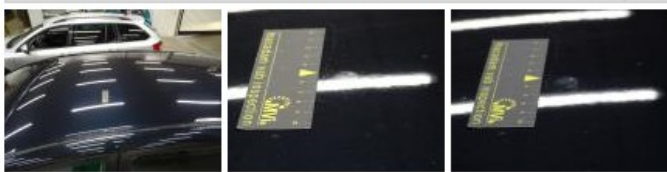



Front bumper, Stone chip(s), Acceptable	0,00
---	------

No pictures to display

Bumper R, Accident, Le - Replace and paint	0,00
--	------



Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18
---	--------



Rear window, Scratch(es), E - Replace	0,00
---------------------------------------	------



Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Handbreak cover, Worn, Acceptable	0,00
-----------------------------------	------

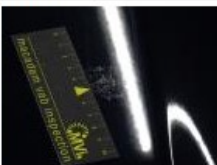

Rear spoiler, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display

Windscreen, Repaired, Acceptable	0,00
----------------------------------	------

No pictures to display

Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display