


SKODA Octavia: 1GRA039

Vinnnumber:	TMBJG7NEXE0188725	Versionname:	OCTAVIA COMBI
First Registrationdate:	4/04/2014	Fiscalpower:	GreenLine Ambition 110PK
Expertise Mileage:	125307	Power Kw:	81
Bodytype:	Break	Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4514
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	SD
GPS storage	Luggage cover
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 T Steel			
Winter tyres:	Fr.L.	Kleber: 6 mm	Fr.R.	Kleber: 6 mm
	Re.L.	Kleber: 7 mm	Re.R.	Kleber: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			779,48
Wheel cover F L, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Windscreen, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Tailgate, Scratch(es), LI - Repair and paint (complete)			301,68





Door frame F L, Bump(s), Acceptable 0,00




Seat cover R L, Stain, Cleaning 25,00



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Bump(s), PDR - Knock out without painting 82,80

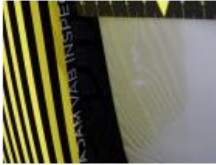

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), E - Replace 370,00

