



VOLKSWAGEN GOLF VII: 1NNT075			
Vinnnumber:	WVWZZZAUZGW235894	Versionname:	1.6 TDI 66KW TRENDLINE
First Registrationdate:	29/03/2016	Fiscalpower:	
Expertise Mileage:	60249	Power Kw:	66
Bodytype:		Body color	Black
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1326
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options	
Windows electric F	Luggage cover
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Manual climate control
Adaptive cruise control	

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	195/65/15/91 H Steel			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes

Total cost ex VAT	546,29
Seat cover F L, Stain, Cleaning	12,50




Wheel cover F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Bonnet, Chemical polution, 67 - Polish	55,19
--	-------

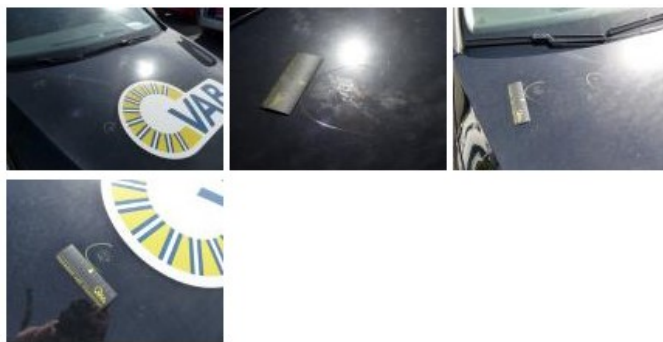

Bodywork, Not original part, Remove lettering	0,00
<i>No pictures to display</i>	
Wing F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Electricity circuit, Not functioning (well), Diagnosis	0,00



Console storage compartment, Damaged, Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	25,00



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Mirror side blinker L, Broken, E - Replace	30,00
--	-------



Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Wheel cover R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	