


MITSUBISHI Outlander: 1DGG446

Vinnnumber:	JMBXMCW7WCF003785	Versionname:	OUTLANDER Nomad+ TC-SST DPF 156PK Aut.
First Registrationdate:	9/05/2012	Fiscalpower:	
Expertise Mileage:	166777	Power Kw:	115
Bodytype:	MPV	Body color	Black
Gearbox:	Automatic	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4808
Number of doors	5		
Number of seats	7		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options

Radio CD	Seats electric F L
TV/DVD screen R	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Steering wheel multifunction	Type of Tow bar
Seats F heated	Tow bar removable
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	225/55/18/95 V LightMetal			
Summer tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm

Assistance equipment

Total cost ex VAT	3725,94
Alloy rim F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	369,84




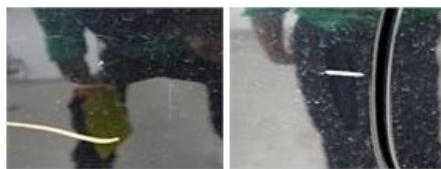

Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 382,02



Floor covering F L, Damaged, E - Replace 264,00

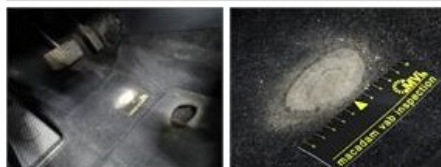

Door R R, Scratch(es), LI - Repair and paint (complete) 382,02



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 382,02



Wing F R, Damaged, Le - Replace and paint 612,02



Maintenance book, Missing, E - Replace 0,00

No pictures to display

Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 369,84



Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete) 362,02



Bumper R, Scratch(es), LI - Repair and paint (complete)

254,16



Sill outer R, Damaged, Le - Replace and paint

348,00

