



PEUGEOT 508: 1DJM229

Vinnnumber:	VF38E9HD8CL045969	Versionname:	508 SW e-HDi Allure BMP 115PK Aut.
First Registrationdate:	4/06/2012	Fiscalpower:	
Expertise Mileage:	113651	Power Kw:	84
Bodytype:		Body color	White
Gearbox:	Automatic	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	1606
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options

Radio CD		Panoramic roof	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	Tow bar removable
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/17/92 H LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm


Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	-----	------	-----

Total cost ex VAT	1054,20
Rear window, Scratch(es), Acceptable	0,00
Engine protective plate, Tear, E - Replace	64,40



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------

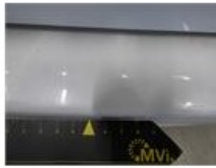

Sill outer R, Rust, LI - Repair and paint (complete)	310,50
--	--------



Protection plate M, Tear, E - Replace	62,00
---------------------------------------	-------



Wing F L, Bad repair, Acceptable	0,00
----------------------------------	------



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Windscreen, Scratch(es), Acceptable	0,00
-------------------------------------	------



Wing F R, Bad repair, Acceptable	0,00
----------------------------------	------



Sill outer L, Rust, LI - Repair and paint (complete)	310,50
--	--------

