



VOLKSWAGEN TRANSPORTER: 1GWL798

Vinnumber:	WV1ZZZ7HZE108155	Versionname:	
First Registrationdate:	3/04/2014	Fiscalpower:	
Expertise Mileage:	152215	Power Kw:	103
Bodytype:	Transporter	Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	3703
Battery functioning	Yes		
Number of doors	5		
Number of seats	3		
Number head rests	3		
Rims summer	Steel		
Category	Light Commercial Vehicle		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	Tow bar fixed
Type of headlighting	Headlighting Xenon
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/65/16/107 T Steel			
Summer tyres:	Fr.L.	Continental: 7 mm	Fr.R.	Continental: 7 mm
	Re.L.	Goodyear: 9 mm	Re.R.	Goodyear: 9 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	-----	------	-----

Total cost ex VAT	2546,76
-------------------	---------

Sidewall RL (LCV), Bump(s), PDR - Knock out without painting	89,00
--	-------



Windscreen, Broken, E - Replace	395,40
---------------------------------	--------



Sliding door R, Bump(s) and scratch(es), LI - Repair and paint (complete)	382,02
---	--------



Bodywork, Not original part, Acceptable 0,00

No pictures to display

Front bumper, Accident, LI - Repair and paint (complete) 158,85



Reflector, Crack, E - Replace 35,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 158,85



Trunk door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 200,00



Wing F R, Accident, LI - Repair and paint (complete) 165,13



Door F R, Scratch(es), Acceptable 0,00

No pictures to display


Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 217,56




Spare wheel, Flat, I - Repair 35,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 231,15

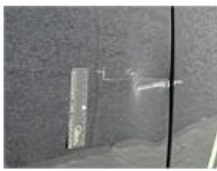

Roof, Bump(s), PDR - Knock out without painting	478,80
---	--------

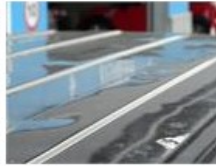

Bumper R, Strained , I - Repair	0,00
---------------------------------	------



Door F L, Strained , I - Repair	0,00
---------------------------------	------

