



BMW 5: 1EU0774			
Vinnumber:	WBAMX11060C978600	Versionname:	5 TOURING 520d
First Registrationdate:	25/03/2013	Fiscalpower:	Start/Stop 163PK
Expertise Mileage:	103593	Power Kw:	120
Bodytype:	Break	Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Back	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3622
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunction	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Winter tyres:	225/55/17/97 H LightMetal			
	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			2920,84
Door F R, Scratch(es), LI - Repair and paint (complete)			382,02



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	369,84
---	--------




Door R R, Scratch(es), LI - Repair and paint (complete) 382,02



Front bumper, Scratch(es), LI - Repair and paint (complete) 254,16



Roof, Chemical polution, LI - Repair and paint (complete) 577,80

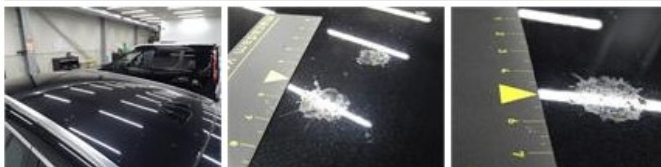

Wing R L, Chemical polution, LI - Repair and paint (complete) 369,84



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Centre console, Crack, E - Replace 78,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

254,16



Bonnet, Dent(s), PDR - Knock out without painting

63,00

