




AUDI A6: 1JFD971			
Vinnnumber:	WAUZZZ4G6EN205130	Versionname:	A6 AVANT Multitr.163PK
First Registrationdate:	1/12/2014	Fiscalpower:	
Expertise Mileage:	170134	Power Kw:	120
Bodytype:	Break	Body color	Dark Blue
Gearbox:	Automatic	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2526
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Head-up Display			

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear			
	225/55/17/101 W LightMetal		
Summer tyres:	Fr.L.	Pirelli: 6 mm	Fr.R.
	Re.L.	Pirelli: 7 mm	Re.R.

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1812,15
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)			95,00

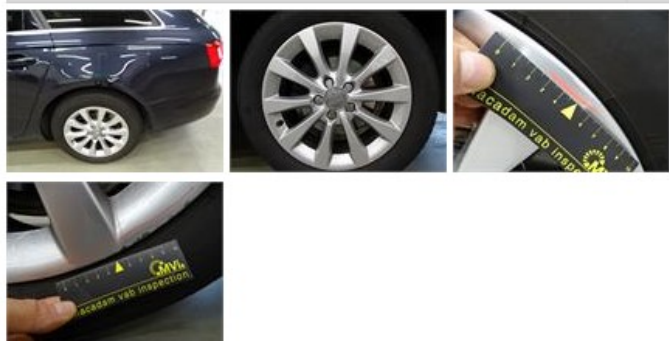

Front bumper, Scratch(es), LI - Repair and paint (complete)		254,16
     		
Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)		372,60
 		
Bonnet, Stone chip(s), Acceptable		0,00
No pictures to display		
Rearview mirror housing R, Scratch(es), Acceptable		0,00
No pictures to display		
Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)		264,21
   		
Alloy rim F L, Scratch(es), LI - Repair and paint (complete)		95,00
   		
Bumper R, Scratch(es), LI - Repair and paint (complete)		254,16
     		
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)		382,02
 		
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)		95,00

