




OPEL Astra: 1FKZ215			
Vinnnumber:	W0LPC6DA7D1130576	Versionname:	ASTRA BER ecoFLEX
First Registrationdate:	1/08/2013	Fiscalpower:	Essentia S&S 95PK
Expertise Mileage:	70843	Power Kwr:	70
Bodytype:		Body color	Black
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3424
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		


Options			
Radio CD		Luggage cover	
Windows electric F		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	215/60/16/95 V Steel			
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes
Total cost ex VAT			1243,99
Tailgate, Dent(s), Acceptable			0,00
No pictures to display			
Rear window, Scratch(es), E - Replace			0,00

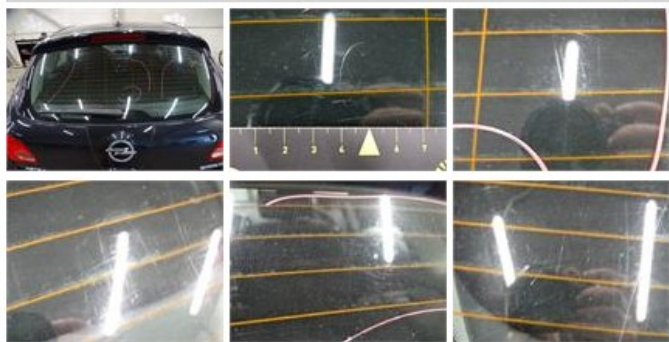

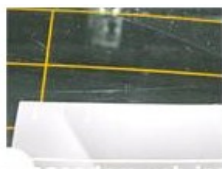

Bonnet, Chemical pollution, LI - Repair and paint (complete)

290,08



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80

