



CITROËN GRAND C4 PICASSO: 1JFY659

Vinnnumber:	VF73A9HC8EJ772752	Versionname:	1.6 E-HDI 115 MAN6 BUSINESS GPS
First Registrationdate:	8/12/2014	Fiscalpower:	
Expertise Mileage:	95836	Power Kw:	85
Bodytype:	MPV	Body color	Red
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2531
Number of doors	5		
Number of seats	7		
Number head rests	7		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunction	Type of Tow bar
Radio multimedia	Tow bar fixed
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H LightMetal			
Summer tyres:	Fr.L.	Fulda: 7 mm	Fr.R.	Fulda: 7 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment

Emergency spare wheel	Yes
-----------------------	------------

Total cost ex VAT	1253,56
Wing R L, Scratch(es), 67 - Polish	0,00
No pictures to display	
Door F L, Dent(s), Acceptable	0,00
No pictures to display	
Seat cover F R, Hole, E - Replace	360,00



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Door F R, Dent(s), Acceptable	0,00
-------------------------------	------

No pictures to display


Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	115,56
--	--------



Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Bonnet, Scratch(es), LI - Repair and paint (complete)	290,08
---	--------

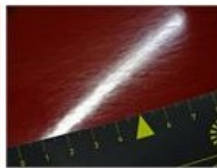

Armrest L, Hole, Smart repair	64,32
-------------------------------	-------

