


SKODA Superb: 1FVX846

Vinnumber:	TMBJJ73T2E9028708	Versionname:	SUPERB COMBI GreenLine Ambition 105PK
First Registrationdate:	13/11/2013	Fiscalpower:	
Expertise Mileage:	117049	Power Kw:	77
Bodytype:	Break	Body color	Dark Brown
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	No	Parking lot	4810
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD Front parking sensors
Windows electric F	Rear parking sensors
Windows electric R	Type of Tow bar
Cruise Control	Tow bar removable
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	No
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


Winter tyres:	205/55/16/91 H LightMetal			
	Fr.L.	Vredestein: 7 mm	Fr.R.	Vredestein: 7 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			696,16
Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)			350,16



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------

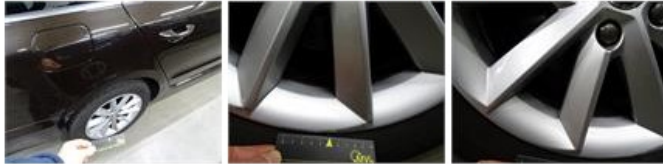

Foglight R, Scratch(es), E - Replace	156,00
--------------------------------------	--------



Alloy rim F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Rocker panel inner F L, Dent(s), Acceptable	0,00
---	------

No pictures to display