



PEUGEOT BOXER: 1GUB039

Vinnumber:	VF3YCTMFB12615373	Versionname:	
First Registrationdate:	28/04/2014	Fiscalpower:	
Expertise Mileage:	108273	Power Kw:	98
Bodytype:	Transporter	Body color	White
Gearbox:	MAN 6 VIT	Paint type	Opaque
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	TRU13
Number of doors	5		
Number of seats	3		
Number head rests	3		
Rims summer	Steel		
Category	Light Commercial Vehicle		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Luggage cover
Windows electric F	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Manual climate control
	No Tow bar

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	No
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/70/15/109 S Steel			
Summer tyres:	Fr.L.	Bridgestone: 2 mm	Fr.R.
	Re.L.	Bridgestone: 4 mm	Re.R.
		Bridgestone: 2 mm	Bridgestone: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Total cost ex VAT			2270,08
Mirror side blinker L, Broken, E - Replace			28,50



Trunk door R L, Dent(s), It - Spot repair

115,56




Rearview mirror R complete, Broken, E - Replace

138,00



Interior, Dirty, Cleaning

100,00

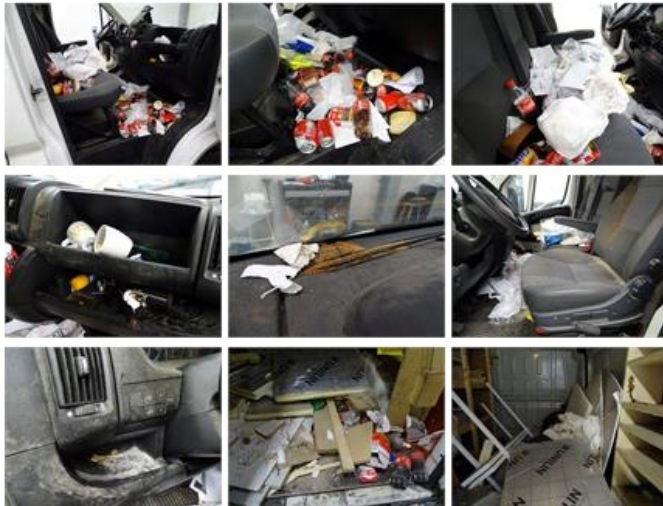

Bumper R, Deformed / Strained, E - Replace

329,40



Rearlight R , Broken, E - Replace

91,50



Sliding door R, Dent(s), Acceptable

0,00

No pictures to display

Bumper F, Scratch(es), Smart repair

110,64



Sidewall RR (LCV), Scratch(es), It - Spot repair

115,56



Roof pillar R, Dent(s), Le - Replace and paint

965,15



Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	165,13
---	--------



Instrument panel cover, Crack, Smart repair	110,64
---	--------

