


SKODA Octavia: 1FQM224

Vinnumber:	TMBJG7NE2E0060687	Versionname:	OCTAVIA COMBI Ambition 105PK
First Registrationdate:	24/09/2013	Fiscalpower:	
Expertise Mileage:	114173	Power Kw:	77
Bodytype:	Break	Body color	Black
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2629
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Fr.R.	Michelin: 4 mm
	Re.L.	Re.R.	Uniroyal: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1584,66
Tailgate, Scratch(es), 67 - Polish			0,00
<i>No pictures to display</i>			
Windscreen, Stone chip(s), Acceptable			0,00
<i>No pictures to display</i>			
Luggage space cover, Deformed / Strained, E - Replace			240,00



Door R L, Bad repair, Acceptable	0,00
----------------------------------	------

No pictures to display


Wing R L, Dent(s), PDR - Paintless dent repair	102,60
--	--------



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Rear window, Scratch(es), E - Replace	0,00
---------------------------------------	------

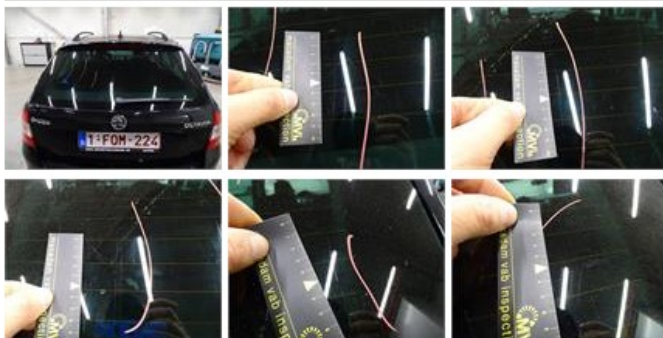

Door F L, Bad repair, Acceptable	0,00
----------------------------------	------

No pictures to display

Bonnet, Dent(s), LI - Repair and paint (complete)	290,08
---	--------



Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	220,18
---	--------

