


FORD MONDEO: 1LVF046

Vinnumber:	WF0EXXWPCEFM65719	Versionname:	2.0 TDCI 132KW S/S ECONETIC BUSINESS ED+
First Registrationdate:	15/12/2015	Fiscalpower:	
Expertise Mileage:	127829	Power Kw:	132
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3426
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	SD	Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2213,35


Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete) 481,50

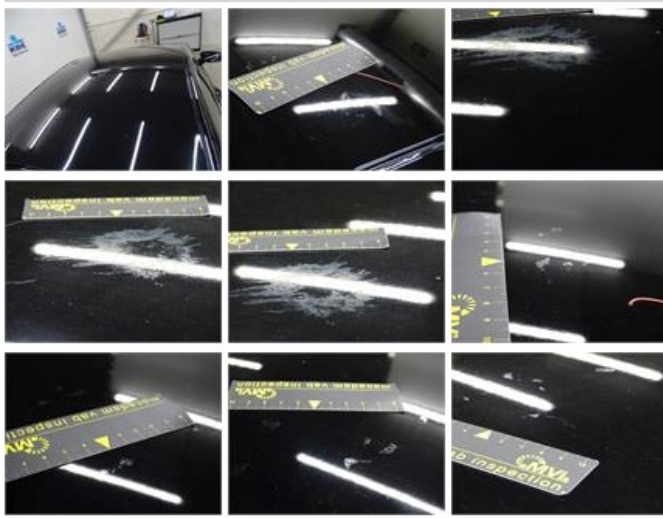

Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Door R L, Dent(s), PDR - Paintless dent repair

63,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80






Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------

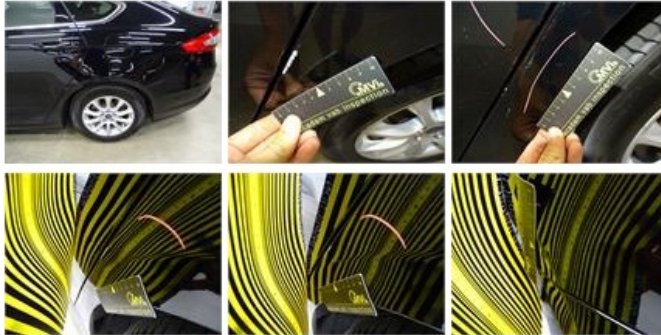

Floor covering F R, Stain, Acceptable	0,00
---------------------------------------	------

No pictures to display

Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Wing F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)	310,50
---	--------



Door F R, Deformed / Strained, LI - Repair and paint (complete)	318,35
---	--------

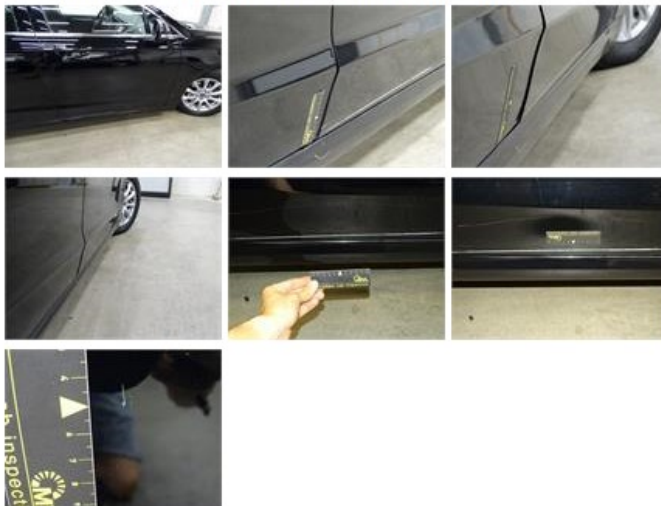

Bonnet, Stone chip(s), Acceptable	0,00
-----------------------------------	------

No pictures to display