



VOLKSWAGEN GOLF VII: 1LAL369

Vinnumber:	WVWZZZAUZGW059694	Versionname:	1.6 TDI 66KW TRENDLINE
First Registrationdate:	3/08/2015	Fiscalpower:	
Expertise Mileage:	98212	Power Kw:	66
Bodytype:	Hatchback	Body color	Dark Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1123
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunctional	Rear parking sensors
Radio multimedia	Type of Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control
Adaptive cruise control	No Tow bar

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 T Steel			
Summer tyres:	Fr.L.	Fulda: 3 mm	Fr.R.
	Re.L.	Fulda: 7 mm	Re.R.

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Total cost ex VAT			810,08
Door F L, Scratch(es), Acceptable			0,00
No pictures to display			
Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)			308,20




Door R L, Dent(s), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

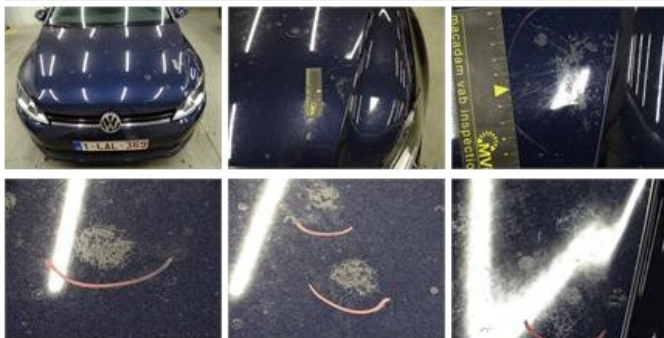

Roof, Chemical polution, 67 - Polish 0,00

No pictures to display