



VOLVO XC60: 1LAL988

Vinnumber:	YV1DZARCDG2813671	Versionname:	2.0 D3 2WD GEARTRONIC VOLVO OCEAN RACE
First Registrationdate:	3/08/2015	Fiscalpower:	
Expertise Mileage:	96317	Power Kw:	110
Bodytype:	SUV	Body color	Black
Gearbox:	Automatic	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3527
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control
Sport seats	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/60/18/107 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	931,23
-------------------	---------------

Alloy rim R L polished, Scratch(es), Acceptable	0,00
---	-------------

No pictures to display

Bumper R, Scratch(es), 67 - Polish	0,00
------------------------------------	-------------


No pictures to display

Tailgate, Scratch(es), 67 - Polish	0,00
------------------------------------	-------------

No pictures to display

No pictures to display

Sill outer L, Scratch(es), LI - Repair and paint (complete)	0,00
---	------

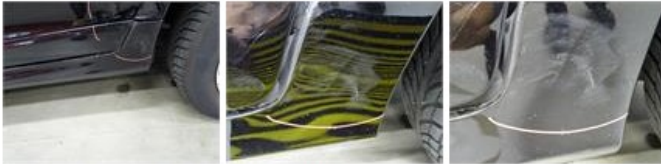

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Bumper spoiler F, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	0,00
---	------




Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Door F L, Scratch(es), LI - Repair and paint (complete)	382,02
---	--------

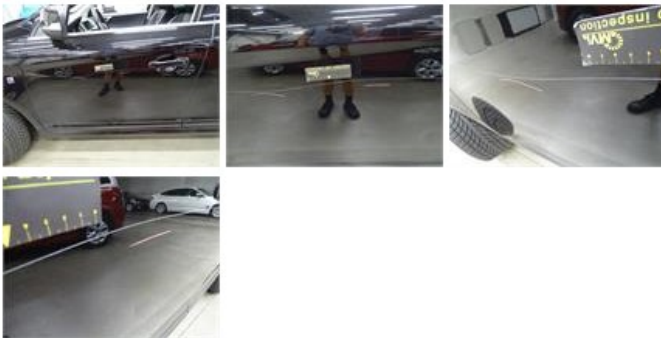

Door R L, Dent(s) and scratch(es), Le - Replace and paint	0,00
---	------





Wing F L, Scratch(es), LI - Repair and paint (complete)	264,21
---	--------



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Door R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bonnet, Stone chip(s), Acceptable	0,00
-----------------------------------	------

No pictures to display