



VOLVO V60: 1KTF296				
Vinnumber:	YV1FW79C1G1287260	Versionname:	2.0 D3 VOLVO OCEAN RACE	
First Registrationdate:	29/06/2015	Fiscalpower:		
Expertise Mileage:	133236	Power Kw:	110	
Bodytype:	Break	Body color	Black	
Gearbox:	MAN 6 VIT	Paint type	Metalic	
Transmission:	Front	Rims summer	Aluminium	
Fueltype:	Diesel	Oil level	OK	
Battery functioning	Yes	Parking lot	2407	
Number of doors	5			
Number of seats	5			
Number head rests	5			
Rims summer	Aluminium			
Category	Passenger Car			
Oil level	OK			
Registration Certificate Car (BE)	Yes			
Options				
Radio CD		Central consol F		
GPS storage	HD	Luggage cover		
GPS storage		Front parking sensors		
Windows electric F		Rear parking sensors		
Windows electric R		Type of Tow bar	No Tow bar	
Cruise Control				
Steering wheel multifunctional				
Seats F heated				
Radio multimedia				
Type of headlighting	Headlighting Xenon			
Type of GPS	GPS big screen color			
Type of Lining	Lining artificial leather			
Type of climate control	Autom climate control			
Limited Technical Inspection				
Airco functioning	OK	Battery functioning	Yes	
Tires wear profile	OK	Power steering	Yes	
Idle position	OK	Sound engine	OK	
Engine startingtime	OK	Clutch test	OK	
Exhaust gass	OK	Wiper fluid level	OK	
Handbrake	OK	Transmission	OK	
		Lighting	OK	
		Wiperblades	OK	
Degree of wear				
Winter tyres:	235/40/18/95 W LightMetal			
	Fr.L.	Vredestein: 5 mm	Fr.R.	Vredestein: 5 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm
Assistance equipment				
Repair kit	Yes	Compressor	Yes	
Number of charging cables (normal)	0			
Number of charging cables (rapid charge)	0			
Total cost ex VAT			2057,80	
Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)			95,00	



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

268,18





Floor covering F R, Hole, Smart repair

64,32




Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Roof, Scratch(es), LI - Repair and paint (complete)

481,50

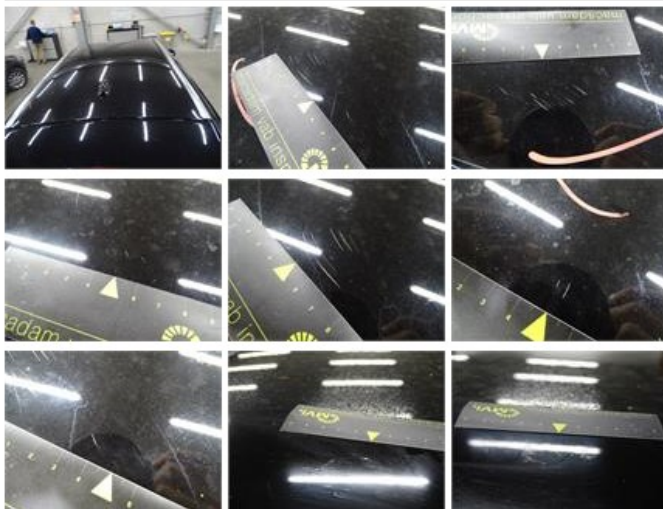

Tyre R L, Tear, Acceptable

0,00



Tyre F L, Tear, E - Replace

132,00



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80





Door R R, Scratch(es), Acceptable	0,00
No pictures to display	
Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)	95,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Tailgate, Scratch(es), Acceptable	0,00
No pictures to display	
Door R L, Scratch(es), Acceptable	0,00
No pictures to display	
Tyre R R, Tear, Acceptable	0,00

