



RENAULT CLIO: 1KTD622

Vinnumber:	VF15RJL0H53062256	Versionname:	1.5 ENERGY DCI 90E EXPRESSION
First Registrationdate:	29/06/2015	Fiscalpower:	
Expertise Mileage:	128817	Power Kw:	66
Bodytype:	Hatchback	Body color	Silver
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4326
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

Winter tyres:	185/65/15/92 T Steel			
	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2112,28
Bonnet, Bad repair, Acceptable	0,00

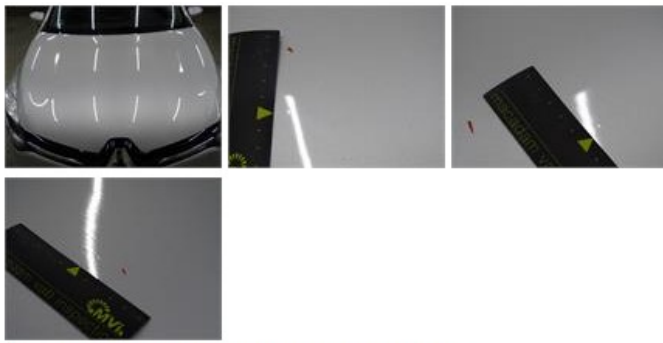

Door R R, Scratch(es), LI - Repair and paint (complete)

254,68



Door F R, Scratch(es), LI - Repair and paint (complete)

254,68



Wheel cover F R, Scratch(es), E - Replace

24,00



Engine protective plate, Deformed / Strained, E - Replace

74,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

246,68



Tailgate, Scratch(es), Acceptable	0,00
No pictures to display	
Rocker panel inner R R, Dent(s), LI - Repair and paint (complete)	115,56



Bumper F, Scratch(es), LI - Repair and paint (complete)	169,44
---	--------



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	246,56
---	--------



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	254,68
---	--------



Roof, Dent(s), Acceptable	0,00
---------------------------	------

No pictures to display	
Wheel cover F L - Scratch(es), Acceptable	0,00

No pictures to display		
Rearview mirror housing L, Scratch(es), Acceptable		0,00
No pictures to display		
Door R L, Scratch(es), LI - Repair and paint (complete)		254,68
		
Wheel cover R L, Scratch(es), E - Replace		24,00
		
Bumper R, Scratch(es), LI - Repair and paint (complete)		169,44
		
Wheel cover R R, Scratch(es), E - Replace		24,00
		
Wing F L, Scratch(es), Acceptable		0,00
No pictures to display		