


VOLVO XC60: 1KTP289

Vinnumber:	YV1DZA8C1G2805297	Versionname:	2.0 D4 2WD MOMENTUM
First Registrationdate:	1/07/2015	Fiscalpower:	
Expertise Mileage:	77167	Power Kw:	140
Bodytype:		Body color	Dark Blue
Gearbox:	MAN 6 VIT	Paint type	Metallic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3605
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	Tow bar fixed
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	235/65/17/108 V LightMetal			
	Fr.L.	Pirelli: 4 mm	Fr.R.	Pirelli: 4 mm
	Re.L.	Pirelli: 5 mm	Re.R.	Pirelli: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2719,59
Roof, Scratch(es), LI - Repair and paint (complete)	577,80



Bumper F, Scratch(es), LI - Repair and paint (complete)

254,16



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete)

369,84



Rearlight R , Scratch(es), E - Replace

132,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

369,84



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Wing F R, Scratch(es), LI - Repair and paint (complete)

264,21




Bumper R, Scratch(es), LI - Repair and paint (complete)	254,16
---	--------



Bonnet, Chemical polution, Acceptable	0,00
---------------------------------------	------

No pictures to display

Door F R, Dent(s) and scratch(es), It - Spot repair	115,56
---	--------

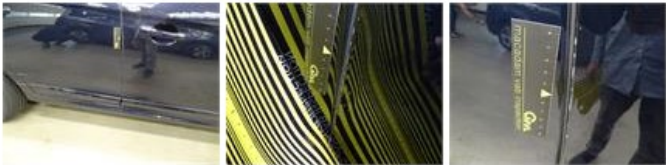

Door R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display