



RENAULT Scenic: 1GWJ326

Vinnumber:	VF1JZ14K649660741	Versionname:	SCENIC Energy Zen 110PK
First Registrationdate:	19/05/2014	Fiscalpower:	
Expertise Mileage:	122215	Power Kw:	81
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1329
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	SD Type of Tow bar
Windows electric F	Tow bar fixed
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining semi-artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/92 H LightMetal				
Summer tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT	4237,24
-------------------	----------------

Bumper corner R R, Scratch(es), Acceptable	0,00
--	-------------

No pictures to display

Wing F L, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

No pictures to display

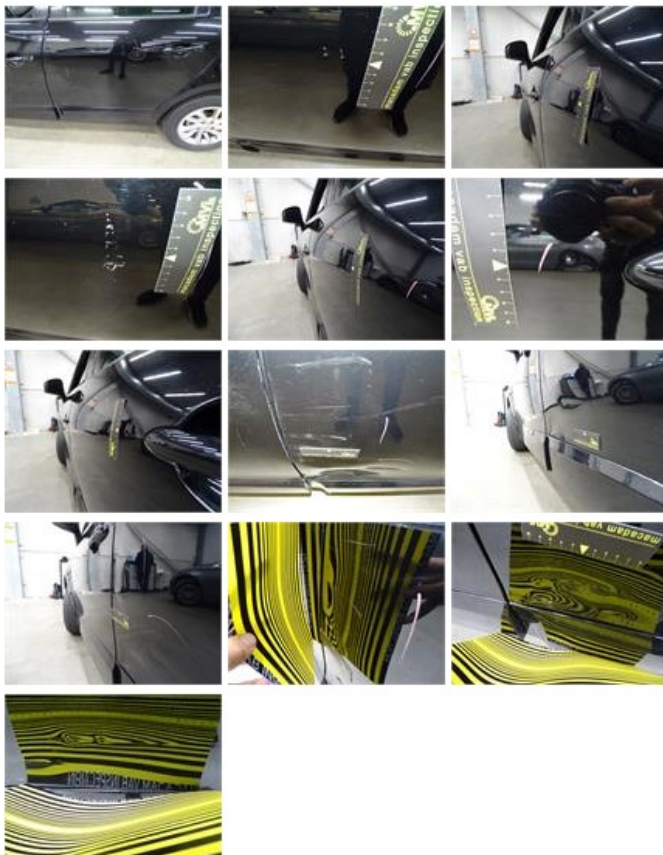

No pictures to display





Backrest cover F L, Worn, Acceptable

0,00



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Dent(s) and scratch(es), Smart repair

110,64



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)


308,20



Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



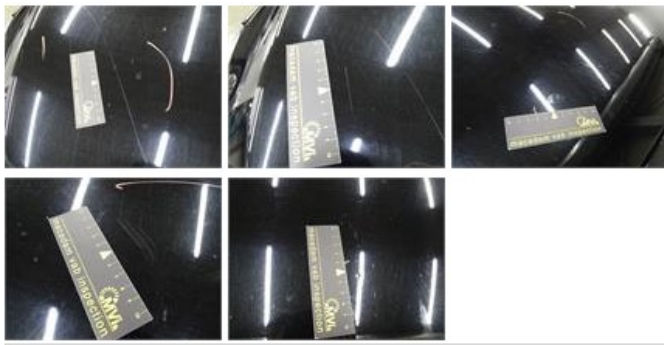

Roof, Chemical polution, LI - Repair and paint (complete)

481,50



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Rearview mirror L complete, Broken, Le - Replace and paint


283,00



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete)

301,68



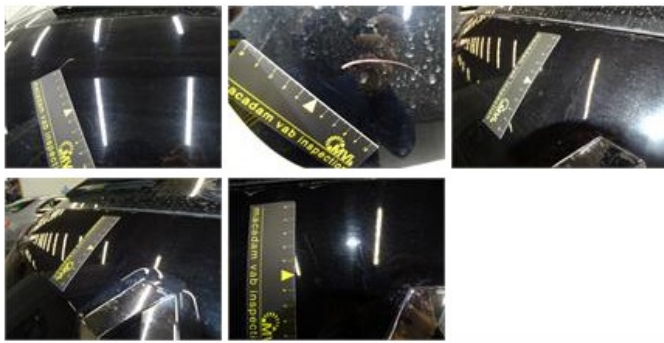

Rear spoiler, Scratch(es), Acceptable 0,00

No pictures to display

Steel rim F R, Not original part, Acceptable 0,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Seat cover F L, Worn, Acceptable 0,00



Wing F R, Chemical polution, LI - Repair and paint (complete) 220,18

