



Volkswagen Passat: 1LGH946

Vinnumber:	WVWZZZ3CZGE065789	Versionname:	
First Registrationdate:	22/09/2015	Fiscalpower:	
Expertise Mileage:	147675	Power Kw:	88
Bodytype:	Break	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2716
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Sun Roof electric	
Windows electric F	Panoramic roof	
Windows electric R	Central consol F	
Cruise Control	Luggage cover	
Steering wheel multifunctional	Front parking sensors	
Seats F heated	Rear parking sensors	
Radio multimedia	Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	
Adaptive cruise control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

215/60/16/95 V LightMetal				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1387,98
Tailgate, Scratch(es), 67 - Polish	0,00
<i>No pictures to display</i>	
Wing R R, Chemical polution, LI - Repair and paint (complete)	308,20

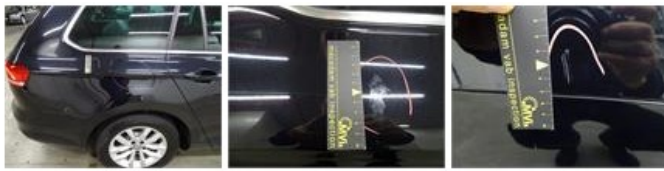

Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete)

481,50




Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20

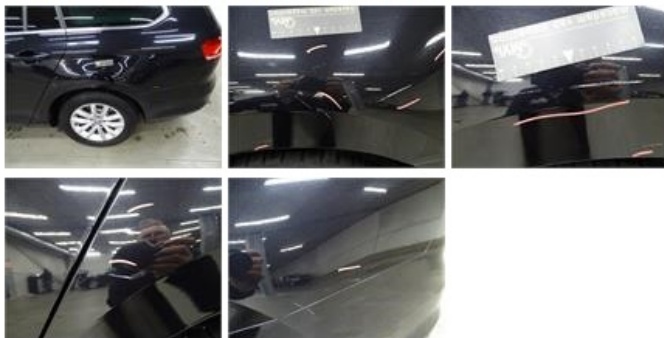

Door F L, Scratch(es), Acceptable

0,00

No pictures to display