



BMW X1: 1JLN071

Vinnumber:	WBAVN71000VY96492	Versionname:	2.0 SDRIVE18D (100KW)
First Registrationdate:	19/01/2015	Fiscalpower:	
Expertise Mileage:	118509	Power Kw:	100
Bodytype:		Body color	Black
Gearbox:	Automatic	Paint type	Metallic
Transmission:	Back	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	3110
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining semi-artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	225/45/18/92 H LightMetal			
	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm


Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1970,78
-------------------	----------------

Tyre F L, Tear, E - Replace	132,00
-----------------------------	---------------

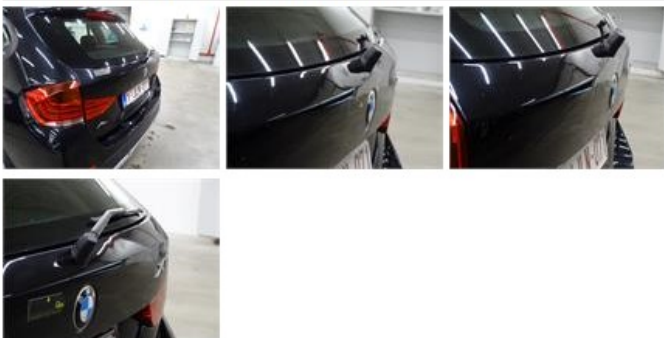

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)		95,00
		
Roof, Chemical pollution, LI - Repair and paint (complete)		481,50
		
Wing R R, Dent(s), Acceptable		0,00
No pictures to display		
Bumper F, Scratch(es), LI - Repair and paint (complete)		211,80
		
Door R L, Scratch(es), Acceptable		0,00
No pictures to display		
Backrest cover F L, Worn, Acceptable		0,00
		
Door R R, Dent(s), Acceptable		0,00
No pictures to display		
Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)		95,00
		
Bonnet, Scratch(es), Acceptable		0,00
No pictures to display		
Door F R, Dent(s), Acceptable		0,00
No pictures to display		
Sill outer R, Scratch(es), Acceptable		0,00
No pictures to display		
Tailgate, Dent(s), LI - Repair and paint (complete)		301,68
		
Floor covering F L, Burned, E - Replace		252,00
		

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------

