


BMW X5: 1KTF293

Vinnumber:	WBAKS410200H68751	Versionname:	3.0 XDRIVE30D 4WD AUTO
First Registrationdate:	29/06/2015	Fiscalpower:	
Expertise Mileage:	81588	Power Kw:	190
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4715
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Type of headlighting	Headlighting LED
Type of GPS	GPS big screen color
Type of Lining	Lining artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	255/50/19/92 H LightMetal			
	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment

	Runflat	Yes
Total cost ex VAT		4164,05
Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)		254,16

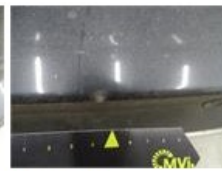

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Outer door handle R R, Crack, Le - Replace and paint

0,00



Door F R, Dent(s) and scratch(es), Le - Replace and paint

1270,21



Alloy rim R R polished, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F R, Scratch(es), It - Spot repair

115,56



Alloy rim F R polished, Scratch(es), Acceptable

0,00

No pictures to display

Protection plate M, Deformed / Strained, E - Replace

62,00



Wing R R, Dent(s) and scratch(es), Le - Replace and paint

1429,81



Door R L, Scratch(es), LI - Repair and paint (complete)

382,02



Fuel cap cover, Broken, Le - Replace and paint

173,27



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Dent(s) and scratch(es), Le - Replace and paint

0,00



Door F L, Scratch(es), LI - Repair and paint (complete)

382,02

