



RENAULT CLIO: 1LUA678			
Vinnumber:	VF15R0J0A54168194	Versionname:	1.5 ENERGY DCI 90E EXPRESSION
First Registrationdate:	4/12/2015	Fiscalpower:	
Expertise Mileage:	96793	Power Kw:	66
Bodytype:		Body color	Red
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	PARKING GARAGE
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options			
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Winter tyres:	185/65/15/92 T Steel			
	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1904,66
Door R L, Scratch(es), Acceptable	0,00
No pictures to display	
Rear window, Scratch(es), Acceptable	0,00




Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 246,56



Bonnet, Deformed / Strained, LI - Repair and paint (complete) 232,06

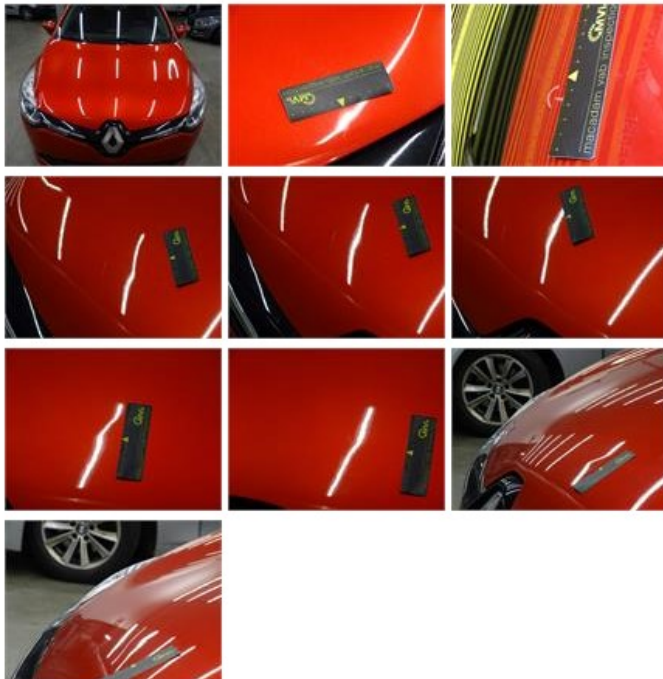

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,68



Wheel cover R R, Scratch(es), E - Replace 24,00



Roof pillar L, Scratch(es), Acceptable	0,00
No pictures to display	
Door F R, Dent(s) and scratch(es), Acceptable	0,00
No pictures to display	
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	246,56



Wheel cover F R, Scratch(es), E - Replace	24,00
---	-------



Bumper F, Scratch(es), Acceptable	0,00
No pictures to display	
Wing F R, Scratch(es), Acceptable	0,00
No pictures to display	
Roof, Scratch(es), LI - Repair and paint (complete)	385,20




Wheel cover F L, Scratch(es), E - Replace	24,00
---	-------





Rear spoiler, Chemical polution, LI - Repair and paint (complete)

115,56

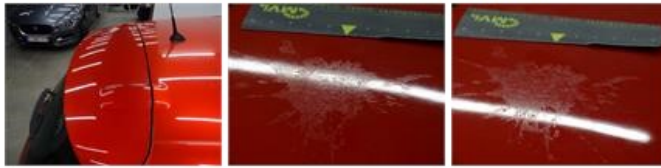

Bumper R, Scratch(es), LI - Repair and paint (complete)

169,44



Wheel cover R L, Scratch(es), E - Replace

24,00



Door F L, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

De-icer nozzle internal L, Broken, E - Replace

153,60



Instrument panel cover, Missing, E - Replace

5,00

